

HALEY & ALDRICH, INC. SITE-SPECIFIC HEALTH & SAFETY PLAN

for

Boeing Realty Corporation Former C-6 Facility

19503 South Normandie Avenue

Project/File No. 27285-005

Prepared by: Mark Golembiewski/Anita Broughton

Date: 8 June 2001

Revised by:

Date:

APPROVALS: The following signatures constitute approval of this Health & Safety Plan. Deviations from this Plan are not permitted without prior approval from the undersigned.

Anita Broughton, H - Office H&S Coordinator

Date

Scott Zachary - Project Manager

Date

Mark Golembiewski, CIH -	Corporate H&S Manager	Date
ELEPTE TO ENDER	WORK HEALTH & SAFELY BE	
I have attended a briefing on declare that I understand and while working on this site.	this Health & Safety Plan prior to the days and agree to follow the provisions and	e start of on-site work and procedures set forth herein
PRINTED NAME	SIGNATURE	DATE
,		
	· · · · · · · · · · · · · · · · · · ·	
· · · · · · · · · · · · · · · · · · ·		
PROFESSION SECTIONS		
	•	
	:	

TO PROJECT	INFORMATION
Name of Project: BRC Former C-6 Facility Investigation/Remediation	H&A File No.: 27285-005
Location: 19503 South Normandie Avenue Los Angeles, CA	
Client/Site Contact: Brian Mossman Stephanie Sibbett	Contact Phone No.: (818) 586-6015 (562) 593-8623
H&A Project Manager: Scott Zachary	PM Phone No.: (619) 818-1790

SCOPE OF WORK:

Activities performed at the site will include utility clearance, drilling operations for the advancement of soil borings and collection of soil samples via direct-push and hollow stem auger methods, stockpile sampling, soil vapor sampling, groundwater monitoring well installation, groundwater sampling, trenching, light construction oversight, installation and operation of soil vapor extraction (SVE) and groundwater remediation systems, and demolition activities.

Subcontractor(s) to be involved in on-site activities:

Name	Work Activity	
West Hazmat Drilling	Soil boring / monitoring well installations	
Water Development Corporation	Soil boring / monitoring well installation	
Geovision	Utility Clearance	
Value Engineering, Inc.	General Contractor (piping, electrical, etc.)	
Baley Construction	Trenching	
Tait Environmental	Groundwater Monitoring	

Projected Start Date: June 1, 2001

Projected Completion Date: Unknown

Estimated Number of Days to Complete Field Work: Unknown

A copy of this Site Health and Safety Plan, along with any addenda containing activity specific health and safety information, will be kept in a conspicuous location on site by Haley & Aldrich personnel at all times while work is being conducted.

NOTE: This Site Health and Safety Plan provides only site-specific descriptions and work procedures. General safety and health compliance programs in support of this site plan, including safe work, training, medical monitoring, and recordkeeping practices, are described in the Haley & Aldrich Corporate Health and Safety Program Manual and are hereby made part of

HALEY & ALDRICH, INC.

Site Specific Health & Safety Plan Boeing Former C-6 Facility 8 June 2001

this plan by reference. The corporate program complies with 8 CCR 5192, Hazardous Waste Operations and Emergency Response. The program manual is available to all employees and to outside parties by request.

Site classification:	X	Industrial	Commercial	Other:
-------------------------	---	------------	------------	--------

The BRC Former C-6 property (formerly Douglas Aircraft) is bounded by a railroad right-of-way and Normandie Avenue to the east, 190th Street to the north, International Light Metals to the west, and Montrose Chemical to the south. The surrounding area consists primarily of industrial and commercial properties with some residential developments. The McDonnell Douglas Corporation operated an aerospace parts manufacturing facility on this site since the 1940s. All of the above ground facility structures have been demolished

Site Status (mark all that apply):

	Active	Inactive
X	Partially Active	Other:

Site history information sources used; check all that apply:

	City Directories		Sanborn Maps
	Geological References		State Files
	Previous report by H&A		Water Quality Maps
X	Previous report by others	X	Inquiries

Is a site plan or sketch available? Y X N If yes, attach a copy to this plan.

Indicate any unusual features at the site (power lines, variable terrain, etc.):

Heavy equipment is often on site due to grading and redevelopment activities not associated with this site investigation.

2.2 Work Areas

List/identify each specific work area(s) on the job site and indicate its location(s) on the site plan:

1. Multiple drilling, trenching, and environmental investigation and construction locations within a vacant lot of approximately 50 acres

3.0 PROJECT TASK BREAKDOWN

List and describe each distinct work task below:

Task No.	Task Description	Employee(s) (approximate)	Work Date(s) or Duration
1	Utility Clearance	1 Geovision 1 H & A	Ongoing
2	Soil boring installation and sampling	2 West Hazmat 1 H & A	Ongoing
3	Stockpile soil sampling	1 H & A	Ongoing
4	Groundwater monitoring well installation	2 West Hazmat 1 H & A	Ongoing
5	Groundwater sampling	2 Tait Environmental	Ongoing
6	Trenching	2 Baley Construction 1 H & A	Ongoing
7	Light construction oversight	1 H & A 1 Boeing	Ongoing
8	Installation of SVE and groundwater remediation systems	1 H & A 2-6 other subcontractors	Ongoing
	Operation of SVE and groundwater remediation systems	1 H & A	Ongoing
10	Demolition activities	1 H & A 2 Baley 1 Boeing	Ongoing

4.0 HAZARD ASSESSMENT

4.1 Chemical Hazards

Is **chemical analysis data** available? YX N Table 1 (attached) summarizes the maximum concentrations of chemicals detected in groundwater. Table 2 (attached) summarizes the maximum concentrations of chemicals detected in soil samples.

Does chemical analysis data indicate that the site is contaminated? YX N_

Potential physical state of the hazardous materials at the site (mark all that apply):

X	Gas/Vapor	T	Sludge
X	Liquid	X	Solid/Particulate

Anticipated/actual class of compounds (mark all that apply):

	Asbestos		Inorganics
X	BTEX		Pesticides
X	Chlorinated Solvents	X	Petroleum products
X	Heavy Metals	Χ	Other: PCBs

Impacted environments (indicate all media in which contamination is expected):

	Air ·	X	Groundwater
X	Soil		Sediment
	Surface water		Other:

Estimated concentrations/medium of major chemicals expected to be encountered by onsite personnel during work activities:

Work Activity	Media	Chemical	Maximum Anticipated Concentration
Soil boring/sampling monitoring activities	SO	Petroleum hydrocarbons Diesel fuel	20,000 mg/Kg 20,000 mg/Kg
Soil boring/sampling monitoring activities	so	PCBs	9.8 mg/Kg
Soil boring/sampling monitoring activities	SO	1,1-dichloroethene Trichloroethylene 1,1,1-TCA	390 mg/Kg 490 mg/Kg 300 mg/Kg

Soil boring/sampling	SO	Arsenic	350 mg/Kg
monitoring activities	i	Hexavalent Chromium	491 mg/Kg
		Lead	1790 mg/Kg
Well installation/	GW	Trichloroethylene	29 ppm
groundwater sampling		1,1,1-trichloroethane	110 ppm
activities		toluene	140 ppm
		methyl isobutyl ketone	100 ppm
		1,1-dichloroethene	88 ppm

(Media key: A = Air; GW = Groundwater; SW = Surface Water; SO = Soil; SE = Sediment)

Table 3 and **Table 4** (attached) provide a summary of the exposure symptoms and the allowable exposure limits, respectively, for the primary chemicals of concern.

Other site (safety) concerns related to the chemicals present on this site: None

4.2 Physical Hazards

Is any site work area(s) to be entered for this project considered a confined space? Y_N_X_

If yes, indicate which area(s) and why:

ALL CONFINED SPACE ENTRIES REQUIRE SPECIAL PROCEDURES, PERMITS AND TRAINING AND MUST BE APPROVED BY THE CORPORATE HEALTH & SAFETY MANAGER

Indicate all hazards that may be present for each task. If any of these potential hazards are checked, it is the project manager's responsibility to determine how to eliminate/minimize the hazard to protect onsite personnel. Note: Task numbers refer to those identified in section 3.

(Highlight the check mark $\lceil \sqrt{\rceil}$, copy and paste in the appropriate box)

Hazards	Task 1	Task 2	Task 3	Task 4	Task 5
Underground utilities		√		√	
Overhead utilities		1		1	
Excavations greater than 4' depth					
Open excavation fall hazards	·				
Heavy equipment		1		√	√
Drilling hazards		√		$\sqrt{}$	
Noise (above 85 dBA)	√	√		V	
Traffic concerns	$\sqrt{}$	$\sqrt{}$	$\sqrt{}$	$\sqrt{}$	$\sqrt{}$
Extreme weather conditions					**************************************
Rough terrain for drilling equipment					
Buried drums					***************************************
Heavy lifting (more than 50 lbs)					
High risk fire hazard					······

Poisonous insects or plants		<u> </u>	
Water hazards			
Use of a boat			
Lockout/Tagout requirements			
Other:		***************************************	

Hazards	Task 6	Task 7	Task 8	Task 9	Task 10
Underground utilities	√		V		\downarrow
Overhead utilities	1	V	√	√	V
Excavations greater than 4' depth					√
Open excavation fall hazards			√		√
Heavy equipment	√ √	√	√	$\sqrt{}$	1
Drilling hazards			√		
Noise (above 85 dBA)	√ √		$\sqrt{}$	$\sqrt{}$	$\sqrt{}$
Traffic concerns		√	√	$\sqrt{}$	$\sqrt{}$
Extreme weather conditions					
Rough terrain for drilling equipment				·	
Buried drums					
Heavy lifting (more than 50 lbs)					
High risk fire hazard					
Poisonous insects or plants					
Water hazards					
Use of a boat					
Lockout/Tagout requirements					
Other:					

Describe any special precautions to be taken with respect to the hazards checked above:

Utility clearance will be performed to identify underground utilities in the areas of trenching and drilling. H&A personnel working on site need to be aware of heavy equipment operations at all times, particularly drilling rig equipment. Extra caution should be exercised when walking near/in drilling, trenching, and demolition areas. Ear plugs or muffs should be available for use as needed. Personnel are not allowed to enter trenches greater than 4 feet deep. Cones and barricade tape will be used to barricade work areas such as open boreholes or trenches.

5.0 PROTECTIVE MEASURES

5.1 Personal Protective Equipment Requirements

a Mile Property PPE Checklist

(Highlight the check mark $[\sqrt{\]}$, copy and paste in the appropriate box)

Required PRE	Task		2 Task 6		Frask5
Hard hat	√ √	1		1 1	
Safety glasses w/side shields		1	1	√ √	1
Steel-toe footwear	1	1	1	√ √	1 1
Hearing protection (plugs, muffs)	√	√ √			
Tyvek ™ coveralls		+	+	+	+
PE-coated Tyvek™ coveralls					
Boots, chemical resistant					
Boot covers, disposable					
Leather work gloves					
Inner gloves – nitrile		1	1	1	1
Outer gloves – nitrile		√	\ \ \ \ \	$\sqrt{}$	1
Tape all wrist/ankle interfaces					
Half-face respirator		*	*	*	*
Full-face respirator					
Organic vapor cartridges		*	*	*	*
Acid gas cartridges		*	*	*	*
Other cartridges: [Enter type here]	:				
P-100 (HEPA) filters		*	*	*	*
Face shield					
High Visibility Vest		√	1	√	$\sqrt{}$
Level of protection required [C or	D	D	D	D	D
D]:		Mod	Mod	Mod	Mod
Modified?					,

THE REQUIRE SINE WELL	Task 6	Task7	Teske		PRIFE
Hard hat	√	1	V	√	V
Safety glasses w/side shields	√	V	√	√	V
Steel-toe footwear		1	√	√	
Hearing protection (plugs, muffs)			$\sqrt{}$	√	$\sqrt{}$
Tyvek ™ coveralls	+		+		+
PE-coated Tyvek™ coveralls					
Boots, chemical resistant	:				
Boot covers, disposable					
Leather work gloves					
Inner gloves – nitrile			$\sqrt{}$		
Outer gloves – nitrile	$\sqrt{}$		$\sqrt{}$		$\sqrt{}$

Tape all wrist/ankle interfaces				T	
Half-face respirator	* .	*	*	*	*
Justification Required PPE (1914)	Task 6	Task 7	Task 8	Task9	Task 10
Full-face respirator					
Organic vapor cartridges	*	*	*	*	*
Acid gas cartridges	*	*	*	*	*
Other cartridges: [Enter type here]					
P-100 (HEPA) filters	*	*	*	*	*
Face shield					
High Visibility Vest	√	√	√	$\sqrt{}$	$\sqrt{}$
Level of protection required [C or	D	D	D	D	D
D]:	Mod	.	Mod	1	Mod
Modified?					

- + Tyvek will be worn by personnel that have potential for contact with contaminated media.
- * If vapor concentrations exceed air monitoring action levels, personnel must don half-face respirators equipped with organic vapor cartridges.

Standby equipment to be available onsite: Half-face air-purifying respirator equipped with organic vapor cartridges and P-100 filters.

5.2 Personal Hygiene Safeguards

When handling soil samples and/or sampling equipment, dermal contact should be avoided. Hands and exposed skin surfaces should be washed thoroughly with soap and water after exiting the exclusion zones and removing contaminated PPE or whenever handling contaminated samples. Site personnel should always be cognizant of the possibility of incidental ingestion of contaminated materials. The site has drinking water, washing water, and restroom facilities available.

Eating and drinking is permitted only in designated locations on the site. These locations will be established, and will likely change, as the work progresses. Changing weather conditions may also be a factor in where the clean "break" locations are established.

No facial hair (e.g., beards) shall be worn on personnel that may don respirators. Long hair must be tied back.

5.3 Site Safety Equipment

Check all items that are required to be on site:

X	Fire extinguisher	X	First aid kit		Flashlight
	Air horn/Signaling device	X	Cellular phone		Duct tape
	Ladder	X	Barricade tape	X	Drum dolly
	Personal flotation devices	X	Safety cones		Harness/Lanyard
	Other, specify:				

5.4 Site Security & Work Area Controls

Access to each contaminated work area will be controlled during on-site activities as follows:

Work zones, including the designation of exclusion zones, will be delineated and controlled by the Haley & Aldrich Site Safety Officer.

Can site access be controlled by a perimeter fence or similar means? Y N X

If not, how will the site/work area be controlled during non-work hours to prevent access by unauthorized persons?

Environmental work area access control is the responsibility of Haley & Aldrich personnel. Site access control is the responsibility of the project redevelopment contractor, Baley Construction.

Work area will be barricaded with traffic cones and barricade tape to prevent access by unauthorized persons. Boreholes will either be completed by the end of each day or traffic covers will be placed over open boreholes during non-work hours. Trenches will either be completed by the end of the day or will be barricaded by traffic cones and barricade tape to prevent access during non-work hours.

5.0 MONITORING PLAN AND EQUIPMENT

Is air/exposure monitoring required at this work site for personal protection? Y_X_N__

Is **perimeter monitoring** required for community protection? Y N X

Monitoring/Screening equipment required to be on site:

X	(HNu analyzer (PID) X 10.2e 11.7eV)		X	Combustible Gas Indicator (CGI) (LEL)			
			V				
	Organic vapor monitor (FID)						Multiple Gas Detector – LEL/O ₂ /H ₂ S/CO
	Photovac Micro Tip, 10.6eV				X	Dust/Aerosol/Fiber count monitor	
	Photovac GC				Colorimetric tubes; Specify:		
	Other:						

Standard action levels and required responses for readings obtained with a multiple gas detector or an individual monitoring instrument are listed below. Do not deviate from these guidelines unless granted specific approval from the Corporate Health and Safety Manager.

Instrument	Normal	Operating levels	Action levels – required responses
Oxygen Meter	20.9%	Between 19.5-	Below 19.5 %: leave area, requires supplied air
		23.5%	Above 23.5%: leave area, fire hazard
CGI	0%	Less than 10%	Greater than 10%: fire/explosion hazard; cease
			work
Hydrogen	0%	Less than 10	Greater than 15 ppm (or 10 ppm for
Sulfide		ppm.	8 hrs) requires supplied air respirator (SAR)
Carbon	0%	Less than 25 ppm	Greater than 200 ppm for 1 hour or
Monoxide			25 ppm for 8 hrs requires SAR

Description of Monitoring Requirements (include frequency and location by Task):

Monitoring Plan for Task Number(s):	2-10	Frequency:	1 1	times per	hour	ĺ
Monto ing ran of task Multiper(s).	2-10	i leducity.	7	miles bei	hour	í .

The work zone and perimeter will be monitored every 15 minutes.

PPE upgrades will be based on the monitoring results and the action levels listed in Table 5 (attached). The Site Safety Officer will be responsible for air monitoring and directing any PPE upgrades based on interpretation of the monitoring results.

Notes: 1. Exposure Guidelines for common contaminants are listed in Table 4 (attached).

2. Record monitoring data and PPE upgrades on **Record of Field Monitoring** form (attached); maintain with project files.

720E STOEGONE PAWINZERON

7.1 Personnel Decontamination

Are **decontamination procedures** required for personnel working on site? Y_X__N ___ If yes, describe steps:

- 1. Wash exterior of boot and outer glove with Alconox solution.
- 2. Rinse outer boot and glove.
- 3. Remove and dispose of outer gloves (if not cleaned to "like new" condition).
- 4. Remove and dispose of coverall.
- 5. Remove and dispose of inner gloves in designated receptacle.
- 6. Field wash for personal hygiene.
- 7. Exit decon area.

Location of decontamination station: South entrance gate to Parcel C by the Baley field office trailer.

Disposal of PPE:

Disposable PPE will be double bagged and disposed of as trash. Other non-disposable equipment will be decontaminated as described below.

7.2 Tools & Equipment Decontamination

Check all **equipment and materials needed for decontamination** of tools and other equipment:

	Acetone	X	Distilled water	X	Poly sheeting
X	Alconox soap	X	Drums for water	X	Steam deaner
X	Brushes		Hexane	X	Tap water
X	Disposal bags		Methanol	X	Washtubs
	Other, specify:				

Outline the equipment decontamination procedures for this project:

1. All sampling equipment will be decontaminated in a triple rinse system consisting of a deionized water and alconox rinse, a deionized water rinse, and then a final rinse with tap water.

- 2. Drill rig equipment will be steam cleaned prior to drilling each boreholes and before transporting equipment off site.
- 3. OVA will be wiped with a wet cloth between monitoring locations.

Disposal methods for contaminated decontamination materials (e.g., wash water, rags, brushes, poly sheeting) will consist of:

Place detergent solutions and rinse water in Department of Transportation (DOT) approved 55- gallon drums.

Place and double bag disposable PPE and poly sheeting in trash receptacle.

Cleaning equipment (e.g. brushes, washtubs, and steam cleaner) will be decontaminated for reuse.

8 0° CONTINGENCY PLAN

EMERGENCY RESPONSE RESOURCES

Nearest Hospital	: Harbour UCLA Medical Center
(see attached map) Address	1000 W. Carson Street
	Torrance, CA
Phone Number	: 310-222-2101
Emergency Response Number	911
Local Emergency Response Number	
(if not on 911 system):	
Other Ambulance, Fire, Police, or	
Environmental Emergency	
Resources:	
Occupational Health Physician:	
Address:	2001 Fourth Avenue, San Diego, CA 92101
Phone Number:	1-619-446-1524
Emergency Phone Number:	1-619-446-1524
Haley & Aldrich Project Manager:	Scott Zachary
Phone Number:	
Emergency Phone Number:	619-818-1790
Haley & Aldrich Field Manager:	Richard M. Farson
Phone Number:	619-280-9210
Emergency Phone Number:	619-818-1761
Client Contact/Project Manager:	Brian Mossman
Phone Number:	818-586-6015
Emergency Phone Number:	818-519-0760
Other Entity:	CHEMTREC (Chemical Transportation Emergency
İ	Center)
	2501 M Street, NW; Washington, DC 20037
Phone Number:	800.424.9300

Evacuation alarms and/or emergency information be communicated among personnel on site by the following means: _X_ Verbal communication. If communication will be by other means, describe:

If necessary, Haley & Aldrich personnel will use an air horn or a vehicle horn to alert site personnel to an emergency situation where immediate evacuation of the work area is required.

Emergency services will be summoned: _X_ Via on-site phone. If contact will be by other

HALEY & ALDRICH, INC.

Site Specific Health & Safety Plan Boeing Former C-6 Facility 8 June 2001

means, describe:

The **site evacuation plan** is as follows: If work zones are established, the Exclusion Zone will have several emergency exits which will allow safe egress in multiple directions from any point onsite. The exit selection will be based on the emergency location, type of emergency, and wind direction. Upon hearing the evacuation signal or otherwise being notified of an evacuation, employees will immediately travel to the assembly area located at the decontamination station.

Employees will follow a route that avoids locations downwind from the emergency. If emergency exits are used, employees will proceed to the assembly area by the quickest route possible, staying close to the perimeter of the Exclusion Zone. When the assembly area is reached, employees will immediately check in with the Haley & Aldrich Field Manager. The site will remain evacuated until the all clear signal has been given.



	(paste map showing route to hospital here)	
-		

TABLE 1

Chemicals Detected in Groundwater Samples Boeing Realty Corporation Former C-6 Facility

Chemical	Maximum Concentrations (ug/l)
1,1- Dichloroethene	88,000
1,1- Dichloroethane	1,400
1,1,1- Trichloroethane	110,000
Trichloroethene	29,000
Methylisobutyl ketone	100,000
cis-1,2 Dichloroethene	7,700
trans-1,2 Dichloroethene	1,000
Benzene	280
Toluene	140,000
Chloroform	2,400
Methyl ethyl ketone	21,000

TABLE 2
CHEMICALS DETECTED IN SOIL SAMPLES
Boeing Realty Corporation Former C-6 Facility

Chemical	Maximum Concentration (mg/kg)
TRPH (a)	20,000
Diesel	20,000
Benzene	1.2
Toluene	3,700
Ethylbenzene	220
Xylenes	2,300
1,1-dichloroethene	162
1,2-dichloroethane	0.0087
1,1,1-trichloroethane	300
1,1,2-trichloroethane	19
trichloroethene	490
tetrachloroethene	99
polychlorinated biphenyls	9.8
Arsenic	350
Hexavalent Chromium	491
Lead	1790

Notes:

(a) TRPH - Total Recoverable Petroleum Hydrocarbons

TABLE 3

CHEMICAL EXPOSURE SYMPTOMS

Boeing Realty Corporation Former C- 6 Facility

CHEMICAL	ACUTE EXPOSURE SYMPTOMS (a)	TARGET ORGANS
Benzene	Irritant to eyes, nose, respiratory system, nausea	Skin, liver, kidneys, respiratory system, cardiovascular system, Central nervous system
Ethylbenzene	Irritant to eyes, mucous Membranes, dermatitis, Narcosis coma	Skin, liver, kidneys, respiratory system, cardiovascular system, Central nervous system
Toluene	Fatigue, weakness, confusion, euphoria, dizziness, headache, dilated pupils	Central nervous system, liver, kidneys, skin
Xylene	Dizziness, excitement, vomiting	Central nervous system, eyes, GI tract, blood, liver, kidneys, skin
Trichloroethene (TCE)	Headache, vertigo, visual disturbance, tremors, nausea, Vomiting, irritated eyes, Dermatitis, cardiac arrhythmia	Respiratory system, heart, liver, kidneys, CNS, skin
Tetrachloroethene (PCE)	Headache, vertigo, visual disturbance, tremors, nausea, vomiting, irritated eyes, nose, and throat	Respiratory system, eyes, liver, kidneys, CNS, skin

Notes:

(a) Sittig, Marshall. 1985. Handbook of Toxic and Hazardous Chemicals and Carcinogens. Park Ridge, New Jersey. Noyes Publications.

TABLE 4 HAZARD MONITORING & EXPOSURE LIMITS

Ammonia Benzana	R, A, I, C	300		25 Cv :				10	Pungent suffa odor
Benzene	R,A,I,C	Ca	1	Sk 0.4	9.2	5 15	0 4.68		Solvent
Carbon tetrachloride (Tetrachlormethane)	R,A,I,C	Ca	2 Cv25 200: 5 m peak	Sk 5 nin Cv 10	11.47	10	50	-	Sweet, pung
Dichlorodifluoromethane (Freon 12)	R,C	1500	1000	1000	11.97	15	_	_	_
1,1-Dichlorcethane	R,I,C	3000	100	100	_	80	200	_	Distinct
,2-Dichloroethane	R,I,A,C	Ca	Cv 100 50	10	11.12*	* 80	88	_	Chloroform
,1-Dichloroethylene Vinylidene chloride, 1,1- ICE	R,I	Ca	-	5 Cv 20	*	40	190		-
,2-Dichlaraethylene	R,I,C	1000	200	200	9.65	50	0.85		Ether-like acri
ihanoi	R,A,I,C	_	1000	1000	10.48**	25	10	-	Sweet
thylbenzene	R,I,C	800	100	Cv 125 100	8.76	100	2.3	E 200	Aromatic
asoline	R,I,C	Ca		300	_	T -	-	E 0.5	Petroleum
exane, n-isomer	R,I,C		50	50	10.18	70	130	ET 1400-1500	Mild, gasoline-li
ethyl Chloroform (1,1,1- CA)	R.I,C	700	350	350	-	105	20-100	-	Chloroform-like
ethylene Chloride ichloromethane, ethylene dichloride)	R,I,C	Ca	25	50	11.35**	100	25-50	E 5000	Ether-like
BK (Hexone)	R.I,C	500	100	50 Cv 75	-	 	†		Pleasant
phthalene	R,A,i,C	250	10	10	8.14	_	0.3	E 15	Mothball-like
rachioroethylene rchioroethylene)	R,I,C	Ca	25	25	9.32	70	4.68	N.T513-690	Ether, chloroform
vene	R,A,I,C	500	200	50	8.82	110	2.14	E300-400	Mothball-like
hioroethylene	R.J.C	Ca (1000)	50	50	9,47	70	21.4		Solventy, chloroform-like
enes	R,A,I,C	1000	100	100	8,56/8.44	111/116	1.1	E.N.T. 200	Aromatic
ITS, MISTS AND CELLANEOUS IPOUNDS				·					
s-54% Chlorine	R,A,I,C	Ca	0.5 mg/m ¹ Sk	0.5 mg/m³ Sk	-		- 1	_ [Mild, hydrocarbon
nic	R,A,I,C	Ca	0.01 mg/m³	0.2 mg/m³	-	-	-	-	-
mium: Species								<u>-</u>	

Notes: All units in ppm unless otherwise noted.

R = Respiratory (Inhalation) ! = Ingestion

A = Skin Absorption

C = Skin and/or Eye Contact

TABLE 4 HAZARD MONITORING & EXPOSURE LIMITS

1	ROUTES OF EXPOSURE	IDLH	PEL	TLV	PID	FID	ODOR THRES- HOLD	IRRITATION THRESHOLD	ODOR DESCRIPTION
Cv = Ceiling value	Ca = Carcinogen		Sk = Skin						

** = Use 11.7 eV lamp

TABLE 5

MONITORING METHOD, ACTION LEVELS AND PROTECTIVE MEASURES

INSTRUMENT	HAZARD	ACTION LEVEL	ACTION RESPONSE		
Respirable Dust Monitor	Contaminant Particles	> 0.5 mg/m ³	Level C Protection		
OVA, HNU ⁽²⁾ , Photovac Microtip	Organic Vapors	Background	Level D Protection		
		3 ppm > background or	Level C, site evacuation may		
		lowest OSHA permissible	be necessary for specific		
		exposure limit, whichever is	compounds		
		lower, or as modified for this			
		task. Sustained for >3 sec in			
·		the breathing zone.			
		50 ppm over background	Level B ⁽³⁾		
		unless lower values required			
		due to respirator protection			
		factors.			
Explosimeter ⁽⁴⁾ (LEL)	Explosive Atmosphere	<10% Scale Reading	Proceed with work		
		10-15% Scale Reading	Monitor with extreme caution		
		>15% Scale Reading	Evacuate site		
² Meter ⁽⁵⁾	Oxygen Deficient Atmosph	e19.5 % O ²	Monitor with caution		
	-	19.5% - 25% 0 ²	Continue with caution		
		< 19.5% 0 ²	Evacuate site; oxygen deficient		
		> 22% 0 ²	Evacuate site; fire hazard		
adiation Meter ⁽⁶⁾	lonizing Radiation	0.1 Millirem/Hour	If > 0.1, radiation sources		
			may be present ⁽⁷⁾		
		> 1 Millirem/Hour	Evacuate site; radiation hazard		
ager Tube	Vapors/Gases	Species Dependent	Consult Table 1 or other		
		> 1 ppm vinyl chloride	resources for concentration		
		> 1 ppm benzene	toxicity/detection data.		
•		> 1 ppm 1,1-DCE	Upgrade to Level C and evacuate		
			Upgrade to Level B if		
			concentration of compounds exceed thresholds shown at		
			left.		
s Chromatograph (GC)	Organic Vapors	3 ppm > background or	One site monitoring or tedlar		
		lowest OSHA permissible	bag sample collection for		
		exposure limit, whichever is	laboratory analysis.		
		lower.			

Notes:

- 1. Monitor breathing zone.
- 2. Can also be used to monitor some inorganic species.
- 3. Positive pressure demand self contained breathing apparatus
- 4. Lower explosive limit (LEL) scale is 0-100%. LEL for most gasses is 15%.
- 5. Normal atmospheric oxygen concentration at sea level is 20%
- 6. Background gamma radiation is ~0.01-0.02 millirems/hour.

7. Contact H&A Health and Safety staff immediately.

TABLE 4
HAZARD MONITORING & EXPOSURE LIMITS

CONTAMINANTS OF	ROUTES OF	IDLI	f PEL	TLV	Pil	D FIL	ODOR THRES- HOLD	1	
				500				INKESHUL	Chem, swee
Acetone	R, I, C	2500	1000	Cv 75	0 9.6	9 60	13		pungent
Ammonia	R, A, I, C	300	50	25 Cv 3	35 -		0.5-2	10	Pungent suifoc odor
Benzene	R,A,I,C	Ca	1	Sk 0.5	5 9.2	5 150	4.68	_	Solvent
Carbon tetrachloride	R,A,I,C	Ca	2	Sk	11.47	10	50	_	Sweet, punge
(Tetrachlormethane)			Cv25 200; 5 m peak	1					
Dichlorodifluoromethane			peak	Cv 10				+	
(Freon 12)	R.C	1500	1000	1000	11.97	15	_	_	_
1,1-Dichloroethane	R,i,C	3000	100	100		80	200	 	Distinct
4.0.02:41			Cv 100 50						
1,2-Dichloroethane	R,I,A,C	Ca	30	10	11.12	80	88	-	Chloroform
1,1-Dichloroethylene (Vinylidene chloride, 1,1-	R,I	Ca	-	5		40	190	_	_
DCE				Cv 20			<u> </u>	<u> </u>	<u> </u>
,2-Dichloroethylene	R,I,C	1000	200	200	9.65	50	0.85		Elher-like acrid
Ethanol	R,A,I,C	 	1000	1000	10.48*	25	10	<u></u>	Sweet
thylbenzene	R,I,C	800	100	CV 125 100	8.76	100	2.3	E 200	Aromatic
Sasoline	R,I,C	Ca	-	300	T	T -		E 0.5	Petroleum
lexane, n-isomer	R,I,C	_	50	50	10.18	70	130	E.T 1400-1500	Mild, gasoline-lik
tethyl Chloroform (1,1,1- CA)	R,I,C	700	350	350	**	105	20-100		- Chioroform-like
lethylene Chloride	R,I,C	Ca	25	50	11.35**	100	25-50	E 5000	Ether-like
Dichloromethane, ethylene dichloride)									
IBK (Hexone)	R,I,C	500	100	50 Cv 75	i. –	_	-		Pleasant
aphthalene	R,A,I,C	250	10	10	8.14	_	0.3	E 15	Mothball-like
trachloroethylene erchloroethylene)	R.I,C	Ca	25	25	9.32	70	4.68	N.T513-690	Ether, chloroform like
luene	R,A,I,C	500	200	50	8.82	110	2.14	E300-400	Mothball-like
chloroethylene	R.I,C	Ca (1000)	50	50	9,47	70	21.4		Soiventy, chloroform-like
enes	R,A,I,C	1000	100	100	8.56/8.44	111/116	1.1	E.N.T. 200	Aromatic
STS, MISTS AND SCELL ANEOUS MPOUNDS		7000	700	100	5.300.44	1111110	5-4	E. 1, 200	
Bs-54% Chlorine	R,A,I,C	Ca	0.5 mg/m³ Sk	0,5 mg/m³ Sk					Mild, hydrocarbon
enic	R,A,I,C	Ca	0.01 mg/m ³	0.2 mg/m ³	-	-		-	-
omium: Species endent	R,I,A,C	25 mg/m ³	Spec Dep	Spec Dep	_	_	_	_	

Notes: All units in ppm unless otherwise noted.

 $R = \text{Respiratory (Inhalation)} \quad I = \text{Ingestion} \qquad A = \text{Skin Absorption}$

C = Skin and/or Eye Contact

Cv = Ceiling value

Ca = Carcinogen

Sk = Skin

** = Use 11.7 eV lamp

TABLE 5
MONITORING METHOD, ACTION LEVELS AND PROTECTIVE MEASURES

INSTRUMENT	HAZARD	ACTION LEVEL	ACTION RESPONSE
Respirable Dust Monitor	Contaminant Particles	> 0.5 mg/m ³	Level C Protection
OVA, HNU ⁽²⁾ , Photovac Microtip	Organic Vapors	Background 3 ppm > background or lowest OSHA permissible exposure limit, whichever is lower, or as modified for this task. Sustained for >3 sec in	Level D Protection Level C, site evacuation may be necessary for specific compounds
·		the breathing zone. 50 ppm over background unless lower values required due to respirator protection factors.	Level B ⁽³⁾
Explosimeter ⁽⁴⁾ (LEL)	Explosive Atmosphere	<10% Scale Reading 10-15% Scale Reading	Proceed with work Monitor with extreme caution
2 (5)		>15% Scale Reading	Evacuate site
² Meter ⁽⁵⁾	Oxygen Deficient Atmosph	19.5 % 0 ⁻¹ 19.5% - 25% 0 ² < 19.5% 0 ² > 22% 0 ²	Monitor with caution Continue with caution Evacuate site; oxygen deficient Evacuate site; fire hazard
adiation Meter ⁽⁶⁾	lonizing Radiation	0.1 Millirem/Hour > 1 Millirem/Hour	If > 0.1, radiation sources may be present ⁽⁷⁾ Evacuate site; radiation hazard
rager Tube	Vapors/Gases	Species Dependent > 1 ppm vinyl chloride > 1 ppm benzene > 1 ppm 1,1-DCE	Consult Table 1 or other resources for concentration toxicity/detection data. Upgrade to Level C and evacuate Upgrade to Level B if concentration of compounds exceed thresholds shown at left.
s Chromatograph (GC)		3 ppm > background or lowest OSHA permissible exposure limit, whichever is lower.	One site monitoring or tedlar bag sample collection for laboratory analysis.

Notes:

- 1. Monitor breathing zone.
- 2. Can also be used to monitor some inorganic species.
- 3. Positive pressure demand self contained breathing apparatus
- 4. Lower explosive limit (LEL) scale is 0-100%. LEL for most gasses is 15%.
- 5. Normal atmospheric oxygen concentration at sea level is 20%
- 6. Background gamma radiation is ~0.01-0.02 millirems/hour.
- 7. Contact H&A Health and Safety staff immediately.

PROJECT LOCATION CLIENT CONTRACTOR			H&A FILE NO. PROJECT MGF FIELD REP DATE	
Project Description:	-			
Task Description:				
			Serial Number	
(OVA, LEL, PID, etc) 2)			Serial Number:	
Calibration and/or operational ch	eck completed as per manufacturers in	structions:	☐ Yes	☐ No
Time completed:				
Weather conditions:				
Reading Type: ⁽¹⁾	Level: (ppm or indicate units)	Time:	-	PPE Level: ⁽²⁾
		`.		
y to Reading Types:				
reathing Zone-BZ erimeter-P urface-S				
A Levels B, C or D				
nents:			······································	